

Location	Item	Priority	Qty	Unit	Unit Cost	Comments	Possible Solution
----------	------	----------	-----	------	-----------	----------	-------------------

1) Grove Park

1a	4	4			\$\$	Belt and tot seat may not share the same swing bay	Replace one type of seat
1b	4	4			\$\$\$	Though the side use zones of swing structures may overlap with other use zones, a distance of 9' is required between the equipment. It appears the distance between swing structures at Grove Park do not meet this 9' requirement.	Move one swing structure
1c	4	4			\$	Bolts may not extend more than two threads beyond the nut (as seen below the decks).	cut off bolt ends
1d	3	3			\$\$	Broken container curbs present tripping hazards	repair curbs

2) Curtiss Field

2a	2	2			\$\$	The double zip slide's chute exit region must be at least 11 inches long horizontally and the vertical distance between the end of the slide and the safety surface shall not exceed 11 inches <i>more pea gravel add part to slide</i>	need additional information to determine course of action
----	---	---	--	--	------	--	---

Priority Scale
 1 - Most Important
 4 - Least Important

Playground Site/Equipment Assessment

Location	Item	Priority	Qty	Unit	Unit Cost	Comments	Possible Solution
2b						The horizontal overhead ladder requires a horizontal distance of 8-10 inches from the platform out to the first handhold. It appears the first handhold measures less than 8 inches horizontally from the platform below.	look to adjust distance to determine course of action
		3			\$	<i>Take out entire piece of monkey bars</i>	
2c						Many entrapment concerns are present in the images. Instances where the vertical or angled climbers reach the platform and coincide with the platform barriers or guardrails are targets for pinch points and entrapments.	possible replacement
		1			\$\$\$\$		
2d						Deck wear and tear has exposed some hardware which presents protrusion concerns.	monitor, for future re-decking or replacement
		3			\$\$		
2e						Belt and tot seats may not share the same swing bay. No more than two seats may occupy a swing bay either. The swing structure at Curtiss Field neglects both requirements.	replace one type of seat
		4			\$\$		
2f		4			TBD	There is no wheelchair access to the play equipment.	not an ADA requirement

Priority Scale
 1 - Most Important
 4 - Least Important

Location	Item	Priority	Qty	Unit	Unit Cost	Comments	Possible Solution
----------	------	----------	-----	------	-----------	----------	-------------------

3) Community Park

3a	4				\$\$	Belt and tot seats may not share the same swing bay.	replace one type of seat
3b	2				\$\$	The standing/sitting surface of a merry-go-round platform intended for 2-5 year olds should have a maximum height of 14" above the protective surface. The merry-go-round at the Community Park may exceed this distance. <i>much adding</i>	add additional fill to reduce height or adjust equipment
3c	4				\$\$\$\$	The 6' use zone to the side of the swing structure appears inhibited on each side (container curbs and trees).	solution may not be practical
3d	1				\$\$\$	Many entrapment concerns are present in the play structure.	need additional information to determine course of action
3e	3				TBD	The upper access area through the guardrail or barrier should be 15 inches wide at most for all climbers. The sliding pole is a specific instance where this guideline is not followed.	unsure of connective measures
3f	3				\$\$\$	Two track rides next to each other should be at least 4 feet apart.	What is the current distance? Can one be moved?
3g	3				\$\$	Though a rubber path is present providing access to the play structure, the raised curb container may restrict this access.	Evaluate Access, Look at moving obstructions

Priority Scale
 1 - Most Important
 4 - Least Important